

**INSTRUCTIONS AND INFORMATION FOR USE
CHEMICAL PROTECTIVE COVERALL – PURA 1.5**

READ CAREFULLY: The existing legislation confer to the employer (user) the responsibility for the identification and for the choice of the adequate PPE on the basis of the risk type correlating to the workplace environment (characteristics of PPE and relative category). It is therefore, appropriate to verify the suitability of the item characteristics with the user needs prior to use. Moreover, the employer must preliminarily inform the worker about the risk types from which he is protected using the PPE, ensuring, if necessary, an education and/or a training, concerning the correct and practical usage of the PPE. The Company declines every responsibility for eventual damages or consequences, due to an improper use, or in case of changes on PPE different from PPE object of certificate. In case that the indications of instructions and information shall not be respected, the PPE shall loss the technical and juridical validity.

<p>Article: PURA 1.5 Description: One-piece coverall with hood, zipper at the front opening covered by adhesive flap, elastic cuffs, ankles and hood; cut and sewn seams. Fabric: 100% polypropylene (55 grams), white colour</p>	<p>Category III Size: S-3XL</p>
--	--

The conformity to type assessment, is done by Centro Tessile Cottoniero & Abbigliamento S.p.A. (Centrocot), Piazza Sant'Anna 2, 21052 Busto Arsizio VA notified body n. 0624, according to Regulation (EU) 2016/425 for Personal Protective Equipment – module C2.


USE: garments object of this instructions and information are in compliance with European standards and they are suitable for the below mentioned usage; they are not suitable for all non-mentioned usage. (in particular concerning all kind of risks related to third category according to Regulation (EU) 2016/425)

EU declaration of conformity may be accessed at the following address: <https://magazin.renania.ro/>

CE MARKING MEANING: guarantees the free circulation of products and goods within the European Economic Community. CE-Marked product complies with the essential requirements of the European Regulation (EU) 2016/425

Pictograms:

EN 13034:2005+A1:2009 – Protection against liquid chemical, light spray, liquid aerosol or low pressure, low volume splashes (type 6)		
EN ISO 13982-1:2004+A1:2010 - Protection against airborne solid particulates (type 5)		
EN 1073-2:2002 Protective clothing against radioactive contamination - Requirement and test methods for non-ventilated protective clothing against particulate radioactive contamination		Clasa 1
EN 1149-5:2018 - Electrostatic charges		
EN ISO 13688:2013 - Protective clothing - general requirements		

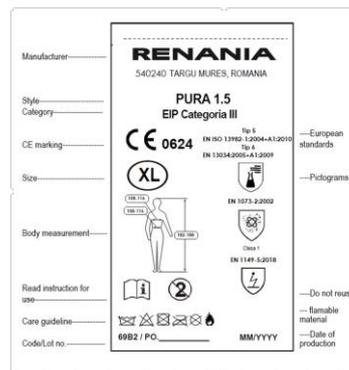

Size	S	M	L	XL	2XL	3XL
Chest	84-92	92-100	100-108	108-116	116-124	124-132
Waist	84-92	92-100	100-108	108-116	116-124	124-132
Height	164-170	170-176	176-182	182-188	188-194	194-200

MAINTENANCE AND CLEANING:



Do not wash Do not bleach Do not dry Do not iron Do not dry clean Flammable fabric

LIMITATIONS: exposition to certain chemicals or high concentrations may require higher barrier properties, either in terms of the performances of material or in the construction of the suit. Such areas can be protected by garments in type 1 to type 4. The user shall be the sole judge of the suitability for the type of protection required and the corrected combinations of coveralls and additional equipment.

LIFETIME: it is suggested to use the product within a period of five years from the date of production written on label Month and year of production: 05/2018

WAY OF DRESSING:

- Make sure that the size corresponds with the user. Do not make any modifications on product.
- Check that the product has no defect and is in good condition (no holes, unsewed parts, etc.)



+40 265 264 817

- Open the zip, dress up taking care not to break the material. Close the zip and sealed the flap. Make the adhesive stripe attaches to the coverall without folding. In case of airborne solid particulates it is advisable to cover and tape the zipper and to wrap the cuffs and ankles with adhesive tape.
- The protection characteristics are valid only if the item is correctly dressed and closed
- Protect uncovered parts of body (hands, respiratory areas, foot) with protective gloves, boots, eventual mask etc. attached to the coverall (if necessary adding adhesive stripe) and offered the same level of protection in order to provide for full body protection

WARNINGS:

- Choose products compatible with area of work
- The disposable item must be replaced after every use
- If any breaking, punctures etc. occur, leave the working area and wear new coverall.
- The prolonged wearing of chemicals protective suits may cause heat stress. Heat stress and discomfort can be reduced or eliminated by using appropriate undergarments or suitable ventilation equipment
- The person wearing the electrostatic dissipative protective clothing shall be properly earthed. The resistance between the person skin and earth shall be less than 108 Ω e.g. by wearing adequate footwear on dissipative or conductive floors;
- Electrostatic dissipative protective clothing shall not be open or removed whilst in presence of flammable or explosive atmospheres or while handling flammable or explosive substances;
- electrostatic dissipative protective clothing is intended to be worn in Zones 1, 2, 20, 21 and 22 (see EN 60079-10-1 [7] and EN 60079-10-2 [8]) in which the minimum ignition energy of any explosive atmosphere is not less than 0,016 mJ;
- electrostatic dissipative protective clothing shall not be used in oxygen enriched atmospheres, or in Zone 0 (see EN 60079-10-1 [7]) without prior approval of the responsible safety engineer;
- the electrostatic dissipative performance of the electrostatic dissipative protective clothing can be affected by wear and tear, laundering and possible contamination;
- electrostatic dissipative protective clothing shall be worn in such a way that it permanently covers all non-complying materials during normal use (including bending movements)
- This coverall meets the requirement Ljmn, 82/90 ≤ 30% Ls 8/10 ≤ 15%
- The method provides a measure of the inward leakage into protective clothing by dry aerosol particles (generated from a sodium chloride solution) having a mass- median aerodynamic diameter of 0,6 µm
- These garments are flammable - Keep away from fire
- Abandon the place of work immediately in case of damage of the product
- The user shall not take off the garment when he is still in the risk area

TRANSPORT, CONSERVATION AND DISCARDING: The item should be transported and conserved in a dry place away from sources of light and heat. If not contaminated the product can be treated as a common textile waist. If contaminated it should be treated as harmful garbage and discarded according to country laws.

PERFORMANCES:

Test on whole suits	Result	classes
Resistance to liquid penetration Spray test type 6 (EN ISO 17491-4 met. A – EN 13034)		PASS
Resistance to aerosol penetration Inward leakage type 5 (EN ISO 13982-2 – EN ISO 13982)	Ljmn 82/90 ≤ 30% Ls 8/10 ≤ 15%	PASS
Nominal protection factor (EN ISO 13982-2 – EN 1073-2)	TILE % TILA % Fpn	Class 1
Practical performance tests (EN 1073-2)		Pass
Seams: strength (EN ISO 13935-2)	75-125 N	Class 3
Test on fabric	Result	Classification
Resistance to penetration to liquid (EN ISO 6530 – EN 13034)	H2SO4 30% <1%	Class 2
	NaOH 10% < 1%	Class 3
	o-xilene < 1%	n.c.
	Butan-1-ol < 1%	n.c.
Repellency to liquid (EN ISO 6530 – EN 13034)	H2SO4 30% > 95%	Class 3
	NaOH 10% > 95%	Class 3
	o-xilene 90-95%	n.c.
	Butan-1-ol 90-95%	n.c.
Abrasion Resistance (EN 530 - method 2)	10-100 cycles	Class 1
Trapezoidal tear resistance (EN ISO 9073-4)	20-40 N	Class 2
Tensile strength (EN ISO 13934-1)	60-100 N	Class 2
Puncture resistance (EN 863 – EN 1073-2)	10-50 N	Class 2
Flex cracking resistance (EN 7854)	>5000 < 15 000 c.	Class 3
Blocking resistance (EN 25978 - EN 1073-2)		Pass
Ignition and flammability (EN 13274-4 - EN 1073-2)		Pass
Electric surface resistance	≤ 2.5 x 10 ⁹	Pass
pH (EN ISO 13688 – ISO 3071)	3.5 > pH > 9.5	Pass



+40 265 264 817